


TECH TALK

NAPA 100025

OE OX 813/1
BMW 11428575211

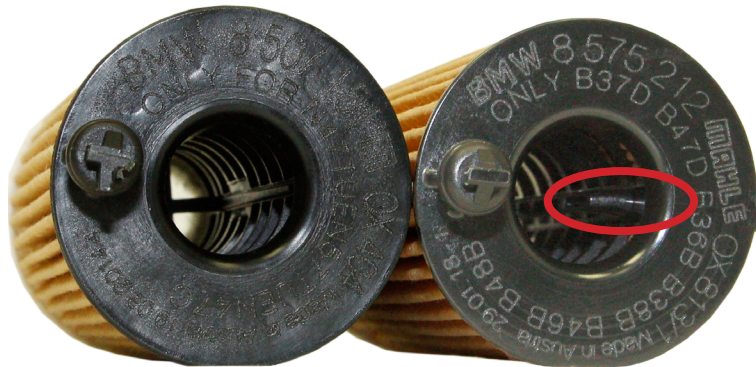


The NAPA 100025 is not a suitable replacement filter for applications requiring the OE filter OX 813/1 (BMW 11428575211). The OX 813/1 has an alignment tab inside of the filter center tube. The tab fits into a slot in the oil housing ensuring proper alignment during filter installation. The NAPA 100025 does not have the alignment tab and can be installed incorrectly resulting in low oil pressure during vehicle operation.

Filter Housing



Center Tube Align Tab

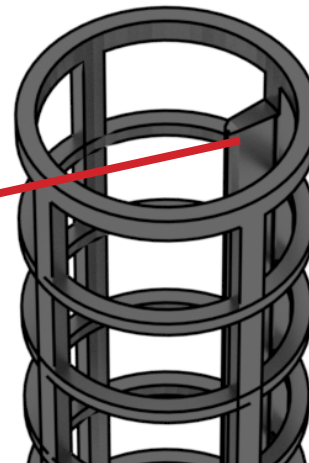

The correct NAPA replacement filter for the OE OX813/1 (BMW 11428575211) is the soon to be available NAPA 100358.

As a reminder, it has always been, and remains our recommendation that the selection of a replacement filter be conducted using only the most current application information available. In today's cataloging, the electronic resources (i.e. Internet, interactive electronic) would be the most current application information available. For questions or more information, please contact your local NAPA District Sales Manager or call Product Information at: US 1.800.949.6698, Mexico +52(844)8661-21-50, Canada 1-800-567-3703.